




McElroy Manufacturing, Inc.
The leader by design.
Tulsa, Oklahoma U.S.A.

DRAWN: BWW	CHECK: BWJ	APPR'D: DWP	DATE: 10/15/04	SHT No: 1	REV No: K	PART No: T1801501
------------	------------	-------------	----------------	-----------	-----------	-------------------

TracStar® 412/TracStar® 618 COWLING ASSEMBLY

NOTE: THIS DRAWING AND THE INFORMATION CONTAINED THEREIN IS THE CONFIDENTIAL AND PROPRIETARY PROPERTY OF McElroy Manufacturing, Inc. THE DRAWING IS NOT TO BE REPRODUCED IN ANY MANNER, SUBMITTED TO OUTSIDE PARTIES FOR EXAMINATION, OR USED DIRECTLY OR INDIRECTLY FOR THE PURPOSES OTHER THAN THOSE FOR WHICH IT WAS FURNISHED WITHOUT WRITTEN PERMISSION OF McElroy Manufacturing, Inc.

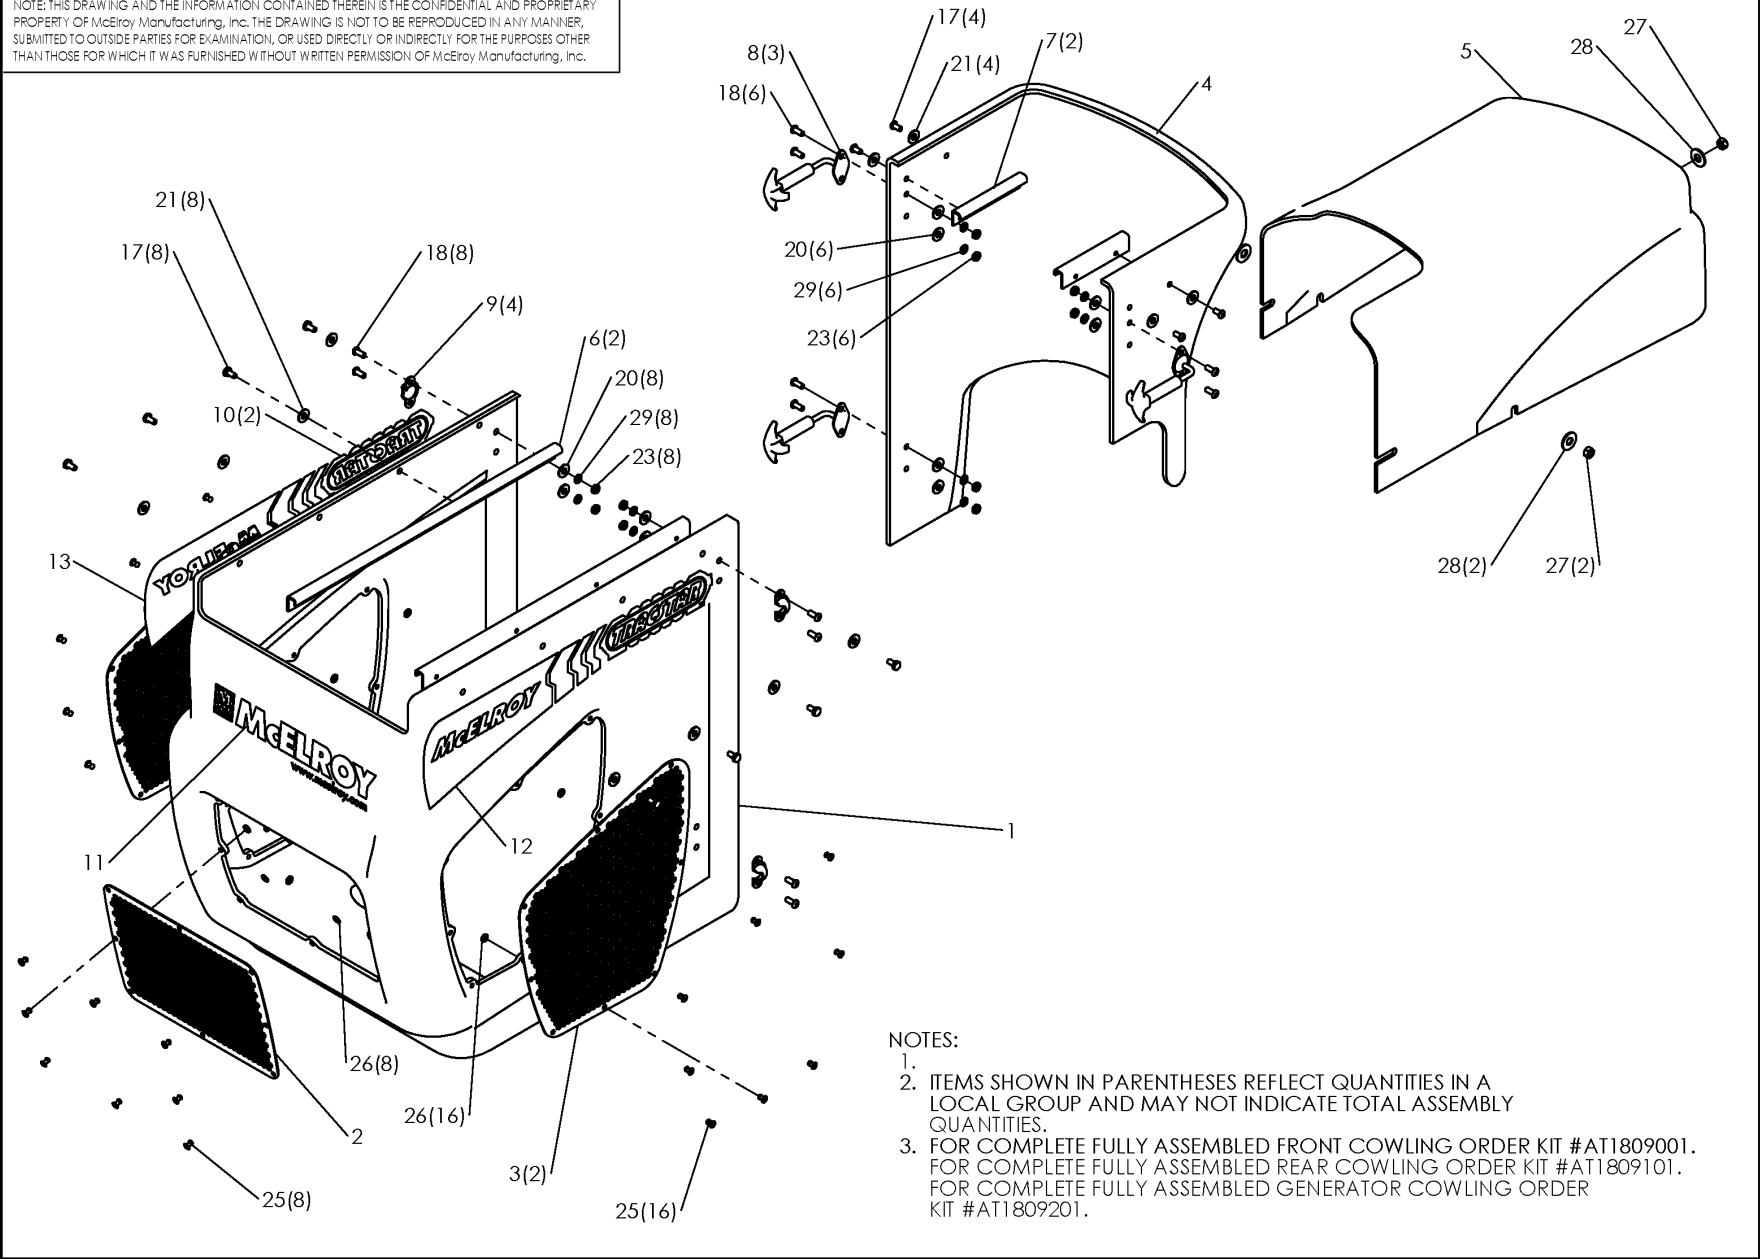

- NOTES:
- 1.
 2. ITEMS SHOWN IN PARENTHESES REFLECT QUANTITIES IN A LOCAL GROUP AND MAY NOT INDICATE TOTAL ASSEMBLY QUANTITIES.
 3. FOR COMPLETE FULLY ASSEMBLED FRONT COWLING ORDER KIT #AT1809001.
FOR COMPLETE FULLY ASSEMBLED REAR COWLING ORDER KIT #AT1809101.
FOR COMPLETE FULLY ASSEMBLED GENERATOR COWLING ORDER KIT #AT1809201.



McElroy Manufacturing Parts List

Part Number: T1801501 TracStar 412/TracStar 618 Cowling Assembly (SEE ADDITIONAL DOCUMENTS BELOW)

Part Number T1801501 Component List

Item	Component	Description	Quantity	Unit	Price
1	T1809101	Rear Cowling	1.0	EA	1,567.00
2	T1808901	Rear Grill	1.0	EA	294.00
3	T1808801	Side Grill	2.0	EA	198.00
4	T1809001	Front Cowling	1.0	EA	619.00
5	T1809201	Generator Cowling	1.0	EA	584.00
6	T1808601	Rear Cowling Slide	2.0	EA	137.00
7	T1808501	Front Cowling Slide	2.0	EA	124.00
8	MJQ00399	Hood Latch	3.0	EA	12.78
9	MJQ00400	Catch Plate	4.0	EA	6.70
10	T5023001	Side Panel Tracstar Logo Label	2.0	EA	11.43
11	T1809301	McElroy Web Logo Label	1.0	EA	19.52
12	T1809401	Right Side Label	1.0	EA	19.50
13	T1809501	Left Side Label	1.0	EA	19.50
14	MJQ00372	Fast Lead Captive Screw (Effective 9/23/04 to 9/26/11)	1.0	EA	5.36
15	MJQ00373	Nylon Retainer for MJQ00372 (Effective 9/23/04 to 9/26/11)	1.0	EA	0.44
17	MAN00045	1/4-28NFX1/2LG Bhscs SS	12.0	EA	1.06
18	MAN00046	1/4-20NCX5/8LG Bhscs SS	14.0	EA	1.06
20	MBF00005	1/4 TY 'a' Wide FL Wshr Stl PL	14.0	EA	0.10
21	MBG00027	1/4 Flat White/nat Nyl Washer	12.0	EA	0.97
23	MBB00005	1/4-20NC Fnsh Jam Nut Stl PL	14.0	EA	0.32
25	MCK00067	3/16DIA X 1/2GRIP AL Blind Rivet (Effective 12/17/07 to 5/15/12)	24.0	EA	0.21
25	MCK00013	3/16DIA X 1/4 Grip Blind Rivet	24.0	EA	0.23
26	MBF00003	#8 TY 'a' Wide FL Wshr Stl PL (Effective 12/17/07 to 12/29/16)	24.0	EA	0.11
26	MBG00124	3/16X3/8 Alum Rivet Washer	24.0	EA	0.60
27	MBC00007	3/8-16NC Fnsh Hex Nyl Lck Nut	3.0	EA	0.71
28	MBF00007	3/8 TY 'a' Wide FL Wshr Stl PL	3.0	EA	0.10
29	MBE00005	1/4 Reg Splt Lck Washer Stl PL	14.0	EA	0.10

Please visit <https://fusion.mcelroy.com/parts> to purchase parts or for more information.